


Inservice Checklist

ScanX Swift View 2.0

Please follow the instructions in the user manual.


Preparation and Exposure of Phosophor Storage Plates

☐ 1. Place ScanX IDX PSP in the matching size ScanX Barrier Envelopes – white side (inactive) facing the clear side of the cover

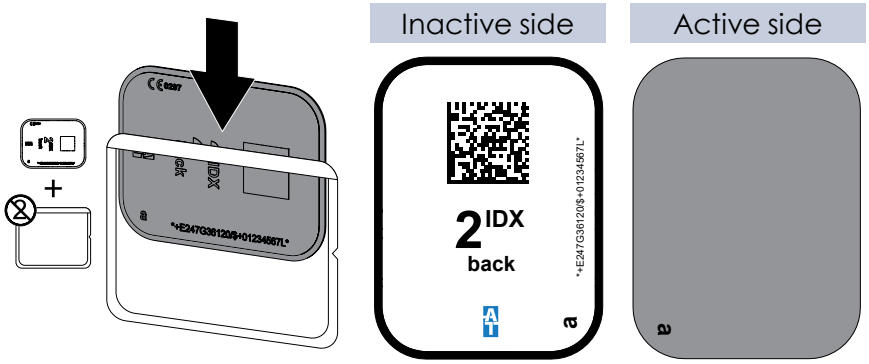

AIR TECHNIQUES equipped for life

☐ 2. Seal the ScanX Barrier Envelope

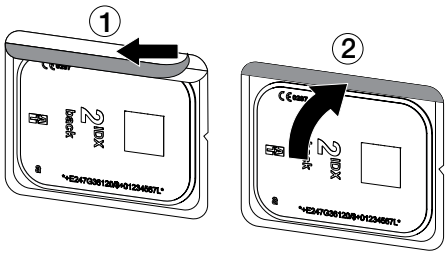


☐ 3. Ensure, that correct X-ray parameters are set at the intraoral X-ray source


	7mA 60kV Tube length 8in	**6mA 70kV Tube length 12in**
Incisors	0.08 sec	0.13 sec
Premolars	0.12 sec	0.18 sec
Molars	0.17 sec	0.25 sec
Bitewing	0.18 sec	0.27 sec

Values are for DC Units. Please check full user manual for values required for units used with collimators.

☐ 4. Expose Phosphor Storage Plate on active side (black part of the cover)

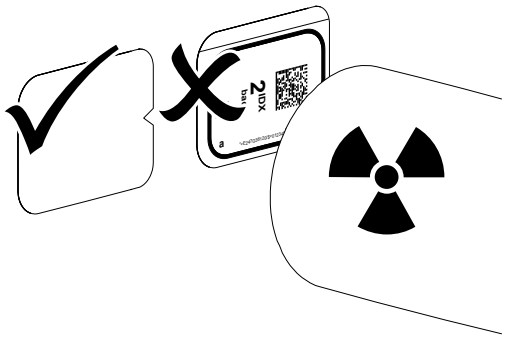


☐ 5. Disinfect Barrier Envelope

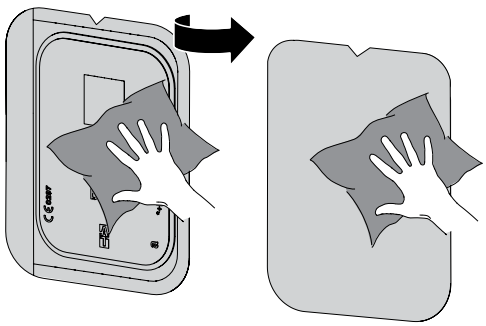

Software

- [ ] 1. Register Patient in Practice Management Software and select X-ray Software link

- [ ] 2. Start X-ray acquisition and select the required setting.

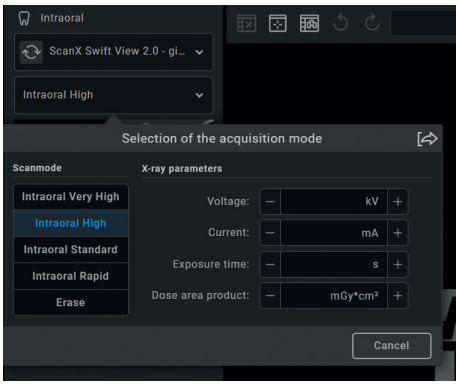

VistaSoft/VistaSoft Connect

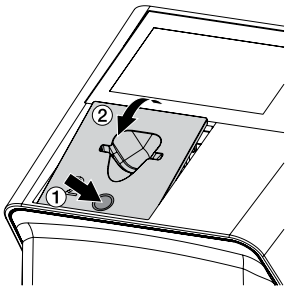


Image Bridge


Operation of ScanX Swift View 2.0 Unit

- [ ] 1. Confirm unit display shows correct patient or job details

- [ ] 2. Ensure correct Plate Guide is in place (Size 0, 1, 2, 3 or 4) and affix the Hygienic Barrier Film



3. Open the Barrier Envelope and insert Phosphor Storage Plate into ScanX unit while leaving the Barrier Envelope in place (only remove once Phosphor Storage Plate is no longer visible). When the PSP is put in the machine, the white side should face you.

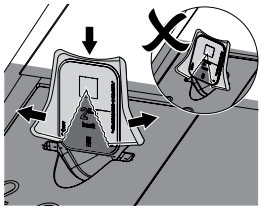

Care & Cleaning

Phosphor Storage Plates: Phosphor Storage Plates should only be cleaned with PSP cleaning wipes (order code: B8910)

ScanX Swift View 2.0 Unit: Disinfect the surfaces with a disinfectant wipe. Alternatively, use a spray disinfectant on a soft, lint-free cloth. Comply with the operating instructions of the disinfectant.

Maintenance

Annually

– Visually inspect device and Phosphor Storage Plate.
– Check belt drive, transport belts and springs and replace if necessary.
– Remove dust and dirt from accessible part.
– Carry out a system check.

Every 3 years

- Change light protection brushes.
- Change roller fixtures.
- Change belt drive.

ScanX Swift View 2.0 Accessories

Barrier Envelopes	
Barrier Envelope Size #0 Pack of 100	73248-0
Barrier Envelope Size #1 Pack of 100	73248-1
Barrier Envelope Size #2 Pack of 300	73248-2
Barrier Envelope Size #2 Pack of 1,000	73248-2K
Barrier Envelope Size #3 Pack of 100	73248-3
Barrier Envelope Size #4 Pack of 50	73428-4

IDX PSPs	
Intraoral IDX PSP Size #0 Pack of 2	G3620
Intraoral IDX PSP Size #1 Pack of 2	G3621
Intraoral IDX PSP Size #2 Pack of 4	G3622
Intraoral IDX PSP Size #2 Pack of 12	G3631
Intraoral IDX PSP Size #3 Pack of 2	G3623
Intraoral IDX PSP Size #4 Pack of 1	G3624

Hygiene	
ScanX Swift Barrier Film, Roll of 900	G8195
PSP Cleaning Wipes, Pack of 50	B8910
Cleaning Sheets for ScanX Swift Pack of 12	G8030
Cleaning Sheets for ScanX Swift Pack of 25	G8035

VistaPosition	
VistaPostion PSP Anterior / Posterior Kit Titanium	G3710
VistaPostion PSP Bitewing Kit Titanium	G3720
VistaPostion PSP Endo Kit Titanium	G3730

PN 9922-629 Rev. A
For more information please contact: Air Techniques
Phone: 516-433-7676
EMail: webforms@airtechniques.com

AIR TECHNIQUES equipped for life